



# ECHOMASTER

## Technical Bulletin

West Coast  
Operations  
2500 East Francis St.  
Ontario, CA 91761

Corporate  
Headquarters  
15500 Lightwave Drive Suite 202  
Clearwater, FL 33760  
800-488-2267  
727-573-9326 (Fax)

**Models Affected:** EM-BUC-KIT-JW, EM-JP-CAM, FC-WRANGLER, FC-WRANGLERPRO, FC-WRANGLERPRO-RSC, PCAM-JP2

**Alert Code:** Medium

**Stated Complaint:** PCAM-220 not fitting into the JP-MOUNT or difficulty inserting the camera into the mount.

**Cause:** It has been found that the spring clips located on the PCAM-220 camera housing may have incorrect bends. These bends cause the diameter of the PCAM-220 camera to exceed diameter of the mounting hole of the JP-MOUNT, resulting in difficulty inserting the PCAM-220 into the JP-MOUNT.

**Solution:** Using a set of Channel Locks or Pliers, compress the three clips located on the camera to be flush with body of camera. Please refer to pictures below for reference.



Using a set of Channel Locks or Pliers, position the tool on the clip as shown above and squeeze to compress the clip. Repeat this for all three clips located on the PCAM-220 camera.



Once completed the clips should be flush with the PCAM-220 body. This will allow the camera to slide into the mounting hole of the JP-MOUNT.